

High-Precision Torque Sensor rotating, contactless

MODEL 8661



Highlights

- Measurement ranges of 0 ... 0.02 N·m to 0 ... 1000 N·m
- Very low linearity error $\leq \pm 0.05\% \text{ F.S.}$
- Output signal 0 ... $\pm 10 \text{ V}$
- Refresh rate 2000 measurements/s

Options

- Speed and angle measurement up to 2000 increments
- Dual range in different graduations
- Shaft end with keyway
- USB port including software

Applications


- Research & development
- Machinery and plant engineering
- Electric motor test
- Suitable for use in all types of test bench



With mounting block



With mounting block and couplings

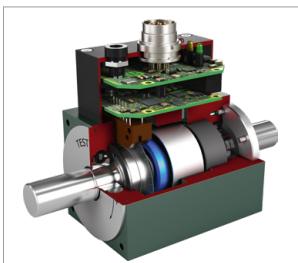

In the cross-section



With couplings

Product description

The non-contact torque sensor type 8661 works according to the strain gage principle. Thanks to the inductive and optical transmission of the signals, the sensor is maintenance-free, the signals are digitized directly on the shaft and made available by the evaluation electronics as a voltage signal or via USB. Thanks to the high-quality bearing, depending on the measuring range, up to 25,000 rpm is possible. The bidirectional voltage output from -10 V ... +10 V allows the direction of rotation to be identified very easily.

To record the speed and angle of rotation, the sensor can optionally be equipped with different number of increments, up to 2000. This speed / angle signal is available as a TTL output signal.

The free DigiVision Light software is available in connection with USB, alternatively drivers for LabVIEW and DASYLab are ready for download.


Connection cables in various lengths, metal bellows couplings and mounting blocks are available for integration in customer-specific systems.

Technical Data

Technical Data

8661	-	5025	5050	5100	5200	5300	5400	5500	5800	6001
Measuring range calibrated in N·m from 0 ...		±25 N·m	±50 N·m	±100 N·m	±200 N·m	±300 N·m	±400 N·m	±500 N·m	±800 N·m	±1000 N·m
Accuracy										
Relative non-linearity							0.05 % F.S.			
Relative non-linearity dual range sensor							0.1 % F.S.			
Relative hysteresis							< 0.1 % F.S. / dual range sensor < 0.2 % F.S.			
Tolerance of sensitivity							±0.1 % F.S. / dual range sensor ±0.2 % F.S.			
Electrical values										
Rated supply voltage range							10 ... 30 V DC (or 5 V via USB)			
DC power consumption							approx. 2 W			
Output voltage at ± rated torque							±10 V			
Output resistance							1 kΩ			
Insulation resistance							> 5 MΩ			
Refresh rate							2000/sec.			
Ripple							< 50 mV _{ss}			
Control signal			10.00 V DC					5.00 V DC		
Resolution							16 bit ± 0.38 mV			
Environmental conditions										
Range of operating and nominal temperature							0 °C ... +60 °C			
Sensitivity of temperature effects							on the zero point 0.015 % F.S./K / 2. measuring range dual range sensor 0.03 % F.S./K on the sensitivity 0.010 % F.S./K / 2. measuring range dual range sensor 0.02 % F.S./K			
Mechanical values										
Dynamic overload safe							recommended 70 % of nominal torque			
Max. operation torque							200 % of nominal torque / dual range sensor 150 %			
Breakaway torque							300 % of nominal torque			
Alternating load							70 % of nominal torque			
Maximum limit axial load	[N]		300					500		
Maximum limit radial load	[N]	125		215			250		500	
Spring constant	[N·m/rad]	14000	25000	40000		150000		220000		
Mass moment of inertia measuring side	[10 ⁻⁶ kg*m ²]	33.3	33.7	35.0			600			
Mass moment of inertia drive side	[10 ⁻⁶ kg*m ²]	85.7	85.9	85.5			1200			
Max. rotary speed	[min ⁻¹]	15000					7000			
Other										
Material							Housing: made of anodized aluminium; Shaft: stainless steel 1.4542			
Protection class							acc. EN 60529, IP40			
Weight	[g]	1500					6000			
Installation										
Installation instructions							Do not exceed the permitted axial and radial forces during fitting and operation. Please refer to our operating instructions for detailed information www.burster.com . Suitable couplings should be used to avoid strain resulting from parallel or angular offset between the shafts.			

Dimensional drawing

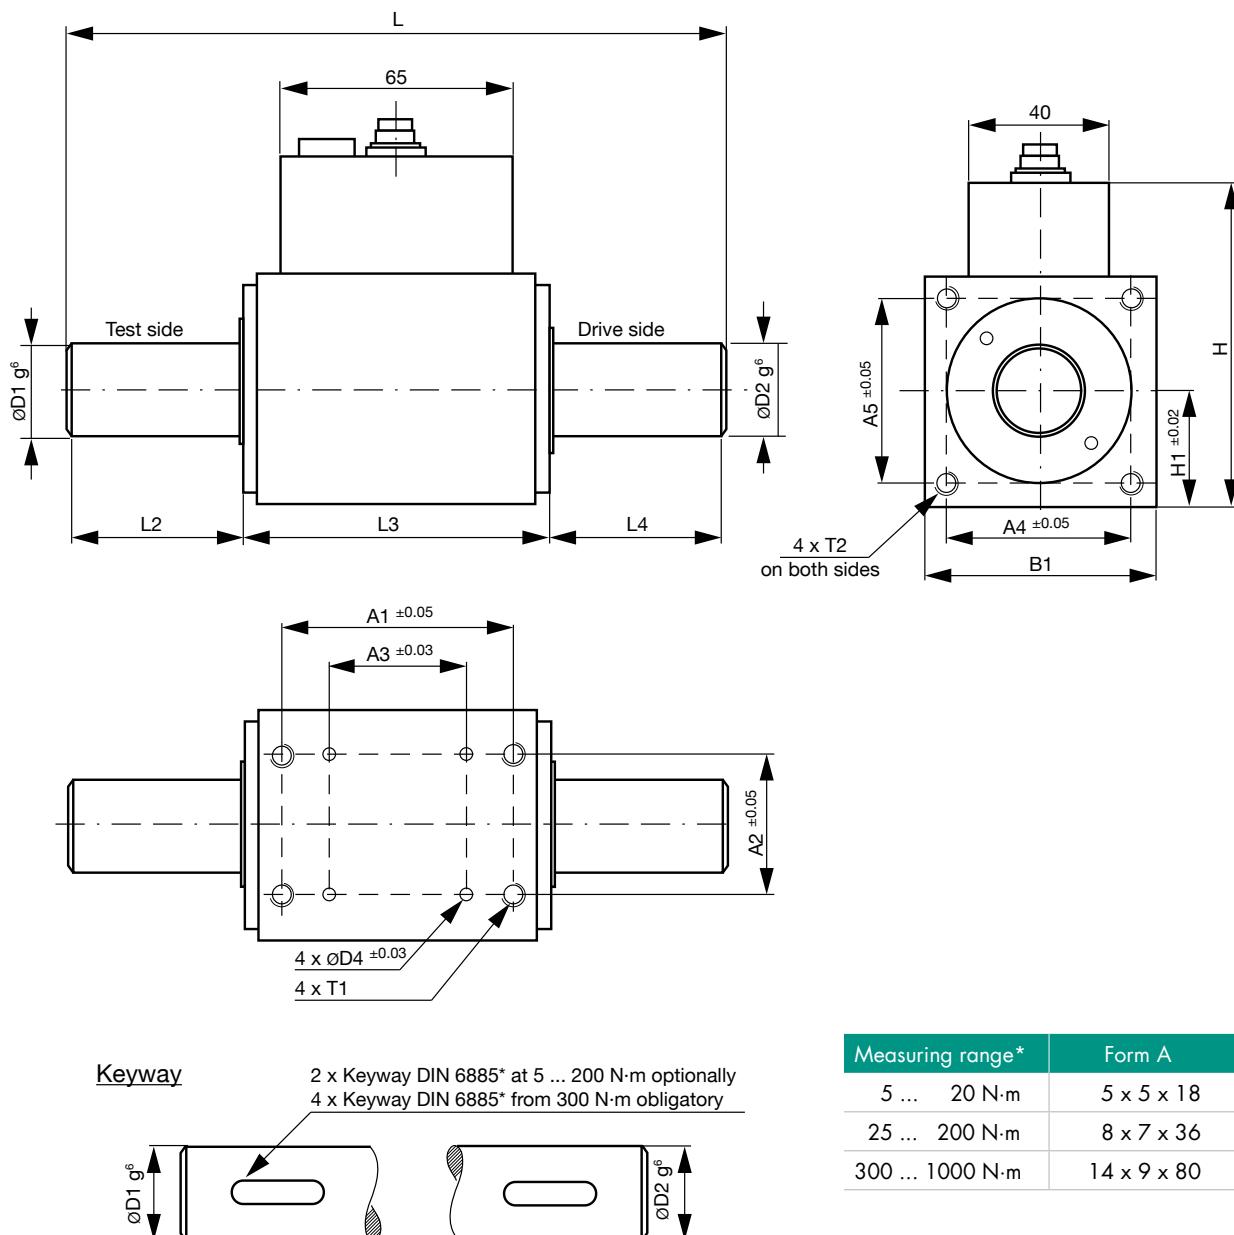

For detailed dimensions you can find sensor CAD data on our website www.burster.com.

All dimensions without tolerance specifications comply with ISO 2768-fH.

8661	-	4020	4050	4100	4200	4500	5001	5002	5005	5010	5020
Measuring range from 0 ...		±0.02 N·m	±0.05 N·m	±0.1 N·m	±0.2 N·m	±0.5 N·m	±1 N·m	±2 N·m	±5 N·m	±10 N·m	±20 N·m
Geometry											
A1	[mm]				45					57	
A2	[mm]				31					44	
A3	[mm]				30					41	
A4	[mm]				26					45.3	
A5	[mm]				24					45.3	
B1	[mm]				40					55	
D1	[mm]			5g6			6g6			15g6	
D2	[mm]			8g6						15g6	
D4 Ø / deep	[mm]				Ø 3.1 / 5						
H	[mm]				60					85	
H1	[mm]				15					27.5	
L	[mm]				87			94		143	
L2	[mm]				10			14		30	
L3	[mm]				66					83	
L4	[mm]				11			14		30	
T1 / deep	[mm]				M4 / 8					M5 / 9	
T2 / deep	[mm]				M3 / 5.5					M4 / 6	

8661	-	5025	5050	5100	5200	5300	5400	5500	5800	6001
Measuring range from 0 ...		±25 N·m	±50 N·m	±100 N·m	±200 N·m	±300 N·m	±400 N·m	±500 N·m	±800 N·m	±1000 N·m
Geometry										
A1	[mm]			57					50	
A2	[mm]			44					90	
A3	[mm]			41					30	
A4	[mm]			54.4					88.4	
A5	[mm]			54.4					88.4	
B1	[mm]			64					107	
D1	[mm]			26g6				45g6		
D2	[mm]			26g6				45g6		
D4 Ø / deep	[mm]			Ø 3.1 / 5				Ø 4.1 / 10		
H	[mm]			94				137		
H1	[mm]			32				53.5		
L	[mm]			168				285		
L2	[mm]			45				95		
L3	[mm]			78				95		
L4	[mm]			45				95		
T1 / deep	[mm]			M5 / 8				M8 / 20		
T2 / deep	[mm]			M4 / 6				M6 / 10		

All dimensions without tolerance specifications comply with ISO 2768-fH.

Electrical values

12-pin connector or USB (Option, USB connection cable included)

Wiring Code depends on the options selected		
Pin	Assignment	Cable colour (99540-000F-052XXXX)
A	NC	
B	Angular exit B	violet
C	Moment output +	yellow
D	Moment output -	green
E	Supply -	blue
F	Supply +	red
G	Angular exit A	pink
H	NC	
J	Ground angle output, measuring range switchover	black
K	Control signal	White
L	Measuring range switchover	brown
M	NC	

Accessories

Mounting block Model 8661-Z00X



If the sensor needs to be replaced, the locating pin speeds up replacement, avoiding the need for laborious realignment. This can be useful especially when the sensor is only used occasionally in the load path. The mounting block has a central hole and special design allowing a range of options for reliable cable attachment. Two clips ensure the sensor is fixed securely. For further information please see accessories data sheet 8661-Z00X

Metal bellow couplings Model 8695



For optimum compensation of misalignment we recommend torsionally free metal bellow couplings. They are characterized by their excellent torsional stiffness during torque load and their low restoring forces. The couplings are optionally with keyways available.

For further information please see accessories data sheet 8695.

Options

USB interface



This sensor version has a USB connection instead of the ± 10 V output. The sensor is powered via USB, no further connections required.

In addition to torque, the speed or rotation angle measured values are optionally available. The calculated mechanical performance in is also displayed in DigiVision.

Free drivers are available for integration into LabVIEW and DASYLab, also a DLL for integration into your own programs.

Dual range

The sensor with two measuring ranges corresponds to its dimensions of the standard version, but has two separately calibrated measuring ranges. The measuring ranges are switched within <50 ms, even during measurement operation, by applying the operating voltage to pin L or via USB.

Torque sensor with integrated rotational speed / angular displacement measurement


8661 torque sensors are optionally available with integrated rotational speed and angular displacement measurement. Two pulse channels with TTL level – channel A and channel B – are always available. For clockwise rotation (looking at the test side), channel A leads channel B with a phase shift of 90°. Only one pulse channel is needed for speed measurement.

For angular displacement measurement (or direction detection), both channels need to be evaluated. To achieve the maximum angular resolution, four-edge decoding must be used to read both the rising and falling edges. For instance an angular resolution of up to 0.045° can then be achieved with an encoder disk having 2000 increments.

Maximum speed:

Encoder disk with 2000 increments: $\leq 3000 \text{ min}^{-1}$
 Encoder disk with 1024 increments: $\leq 6000 \text{ min}^{-1}$
 Encoder disk with 400 increments: $\leq 15000 \text{ min}^{-1}$
 Encoder disk with 240 increments: $\leq 25000 \text{ min}^{-1}$

Increments	from 0 ... 0,02 N·m to 0 ... 2 N·m	from 0 ... 5 N·m to 0 ... 200 N·m	from 0 ... 300 N·m to 0 ... 1000 N·m
2000	-	yes	-
1024	yes	yes	yes
400	yes	yes	-
240	yes	-	-

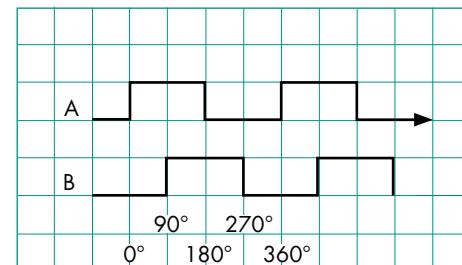


The measuring accuracy of the rotational speed and angular displacement measurement is directly related to the speed and the encoder disk used. With the USB option, another influencing factor is the setting of the averaging, which should be adapted to the speed range used.

DigiVision configuration and analysis software

Features

- Tare function
- Configuration options for averaging and filters; value stored in sensor
- Intuitive user interface
- Automatic sensor identification
- Sensor calibration data readout

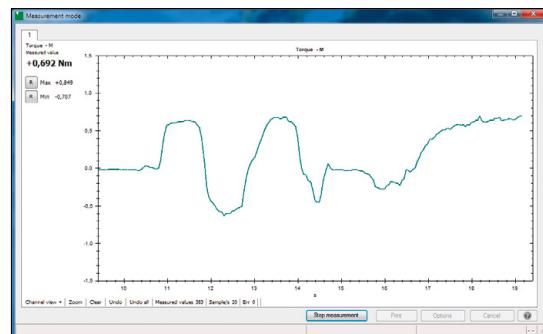

DigiVision Light PC software

freely available on our website

DigiVision configuration and analysis software max. 200 measured value/s for one sensor

DigiVision Standard PC software

Model 8661-P100

DigiVision configuration and analysis software up to 16 channels, no limit to the refresh rate

PC-Software DigiVision Professional

Model 8661-P200

DigiVision configuration and analysis software with additional configurable maths channel; up to 32 channels

- Numerical & graphical display and measurement of the physical torque value
- Practical start and stop trigger functions
- 4 limits can be configured for each measurement channel
- MIN/MAX value acquisition
- Automatic scaling
- Measurement reports can be saved as Excel or PDF file
- Archive viewer for displaying sets of curves
- X Multichannel measurements, even with different sensors (e.g. 9206, 8631, 8625) available with standard version

Accessories

Order code

9940	Mating connection 12 pin
9900-V539	Mating connection 90°-angle
99540-000F-0520030	Connecting cable, length 3 m, other end free
99539-000F-0520030	Connecting cable, length 3 m, plug with 90°-angle, other end free
99209-540G-0160030	Connecting cable for model 7281 and model 9311, length 3 m, with external supply
99163-540A-0520030	Connecting cable, length 3 m, 8661 to DIGIFORCE® 9307 combined channel D (option channel)
99209-215A-0090004	Adapter cable to DIGIFORCE® 9307 standard channel A/B and C (usable only in connection with type 99163-540A-052xxxx)
8661-Z010	USB cable connector type A, type BMini, length 2 m, black (included with USB option)
8661-P100	DigiVision Standard configuration and analysis software; up to 16 channels
8661-P200	DigiVision Professional with additional configurable maths channel; up to 32 channels
8600-Z00X	Mounting block, see accessories data sheet 8661-Z00X
8600-Z010	Power pack for external supply

Calibration

Manufacturer Calibration Certificate (WKS)

Special calibration for clockwise or/and counter clockwise direction torque, in 20 % steps of range up and down.

Calibration Certificate with accreditation symbol

Calibration certificate with accreditation symbol per DIN 51309, clockwise or/and anticlockwise torque, with eight steps spaced across the measurement range, increasing and decreasing.

Order code

Measuring Range	Code			
0 ... ± 0.02 N·m	4	0	2	0
0 ... ± 0.05 N·m	4	0	5	0
0 ... ± 0.1 N·m	4	1	0	0
0 ... ± 0.2 N·m	4	2	0	0
0 ... ± 0.5 N·m	4	5	0	0
0 ... ± 1 N·m	5	0	0	1
0 ... ± 2 N·m	5	0	0	2
0 ... ± 5 N·m	5	0	0	5
0 ... ± 10 N·m	5	0	1	0
0 ... ± 20 N·m	5	0	2	0
0 ... ± 25 N·m	5	0	2	5
0 ... ± 50 N·m	5	0	5	0
0 ... ± 100 N·m	5	1	0	0
0 ... ± 200 N·m	5	2	0	0
0 ... ± 300 N·m	5	3	0	0
0 ... ± 400 N·m	5	4	0	0
0 ... ± 500 N·m	5	5	0	0
0 ... ± 800 N·m	5	8	0	0
0 ... ± 1000 N·m	6	0	0	1
				Standard
				0 0 0 0
8	6	6	1	-
				- V

Standard sensor

■ Standard sensor, one measuring range	0
■ Dual-range version, graduation 1:10 available ≥ 2 N·m	1
■ Dual-range version, graduation 1:5 available ≥ 0.5 N·m	2
■ Dual-range version, graduation 1:4 available ≥ 2 N·m	3
■ Dual-range version, graduation 1:2 available ≥ 1 N·m	4

■ Without speed/angle measurement	0
■ Speed/angle measurement 400 increments	1
■ Speed/angle measurement 1024 increments	2
■ Speed/angle measurement 240 increments	3
■ Speed/angle measurement 2000 increments	4

Output signals

■ Output voltage 0 ... ± 10 V	0
■ USB interface	1
■ Output voltage 0 ... ± 5 V	2

Versions	
■ Round shaft ends	0
■ Shaft ends with keyway	2